

RIFF JTAG Error codes and troubleshooting

ERROR: Wrong response code from the RIFF Box: 0x44

1.9. Error code 0x44

Returned by the box's firmware if attempted target HALT operation failed.

Solution:

Check target device connection. In case You're trying to access device based on MSM8255/MSM8655 CPU, this error can be caused by CPU fuses. In case that there is no boot device present, or DBL (FSBL) partition is damaged, fused devices will return this error.

Example - HTC phones with damaged eMMC.

Unique solution ID: #1013

Author: Legija

Last update: 2013-05-17 16:49